
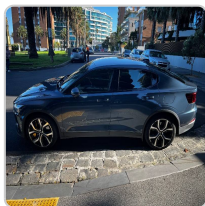


Pre Purchase Inspection Report

Polestar Polestar2

Reference Number: a1739687-c183-49dc-b1bf-8df7e61f4549

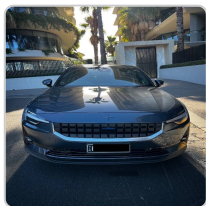

Vehicle Information


VIN
YSMVSEDA8PL117225

Model Year
2022

Odometer Reading
53868

Registration Number
CCM909

Report Summary

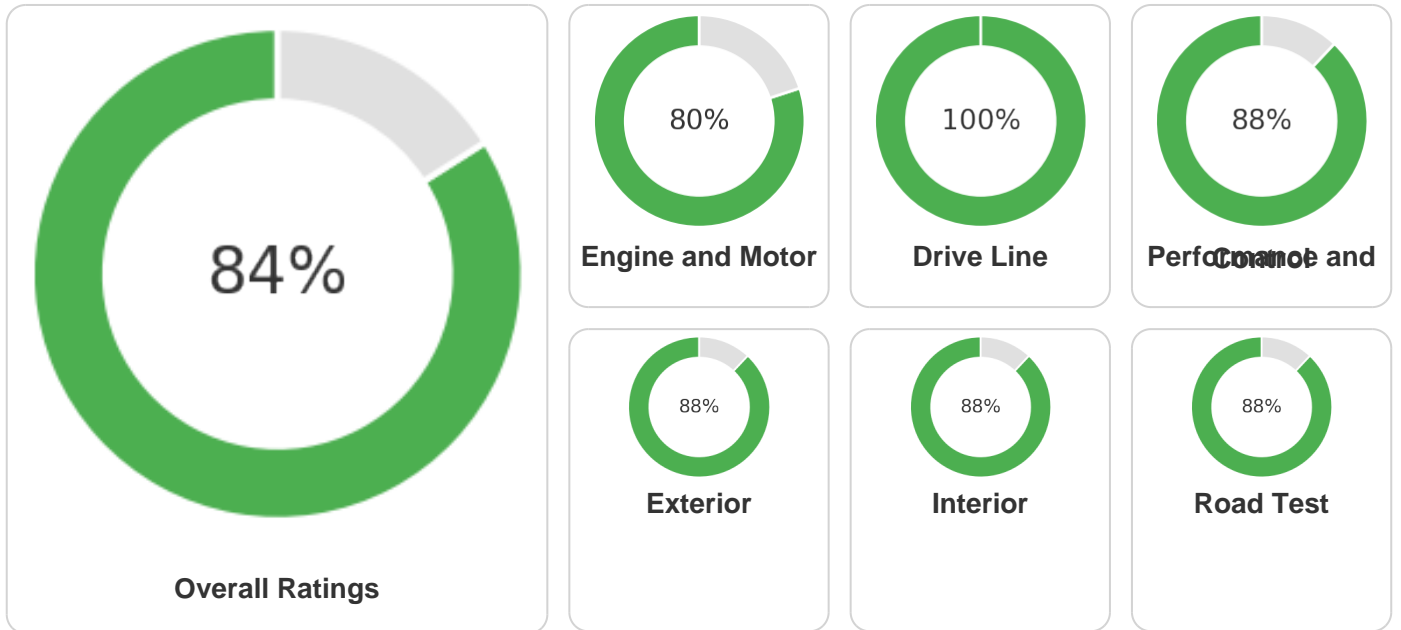

Diaa / Inspector

Inspector's overall review



The 2022 Polestar 2 presented in an overall good condition consistent with its age, make, model and kilometres. An Aviloo battery test was conducted, which returned an excellent result, indicating the battery is in very strong condition with minimal degradation. This is a highly positive outcome, particularly as the battery is the most critical component in an electric vehicle. During the inspection, a few minor issues were identified. Minor cracks were noted on the front lower control arm rear bushes, and the passenger side sunvisor cover was found to be broken. Cosmetically, the vehicle shows signs of wear and has not been particularly well maintained, with several scratches noted internally and externally. On the road test, the vehicle exhibited a slight pull to the left, which may require a wheel alignment or further inspection. The vehicle otherwise drove smoothly with no abnormal noises or vibrations noted from the electric drive system. Apart from the above, no major mechanical or electrical concerns were identified at the time of inspection. It is recommended to proceed with the purchase, with the vehicle considered a safe and reliable option, subject to addressing the minor items outlined above.

Engine and Motor

Part	Comments	Rating (Out of 5)
Battery health & Alternation operation		3 ★ ★ ★ ★ ★

Part	Comments	Rating (Out of 5)
Engine bay fluid levels & condition / Washer bottle.	N/A	0 ★ ★ ★ ★ ★
Radiator fan, Hoses, Reservoir, Thermostats housing and Water pump	N/A	0 ★ ★ ★ ★ ★
Heater hoses, AC condenser, Compressor & Lines	N/A	0 ★ ★ ★ ★ ★
Drive belt and tensioner	N/A	0 ★ ★ ★ ★ ★
Power steering pump & hoses / Electronic power steering.		5 ★ ★ ★ ★ ★
Exhaust	N/A	0 ★ ★ ★ ★ ★
Fuel pump / Fuel line / fuel injectors	N/A	0 ★ ★ ★ ★ ★
Starter motor	N/A	0 ★ ★ ★ ★ ★
Air intake & induction system (intake manifold, pipes, hoses, air filter housing)	N/A	0 ★ ★ ★ ★ ★


Part	Comments	Rating (Out of 5)
Turbo charger / Super Charger	N/A	0 ★ ★ ★ ★ ★
Engine bay electrical (fuse box, relays, main wiring looms, battery terminals)	Can not be tested due to components being concealed under covers and not accessible without disassembly.	0 ★ ★ ★ ★ ★
Oil cap deposit, Head gasket leakage, Oil leaks, Engine health, Ignition System	N/A	0 ★ ★ ★ ★ ★
Engine & transmission mounts.	N/A	0 ★ ★ ★ ★ ★
Engine idling	Can not be tested due to components being concealed under covers and not accessible without disassembly.	0 ★ ★ ★ ★ ★
ECU Scan	N/A	0 ★ ★ ★ ★ ★


Drive Line

Part	Comments	Rating (Out of 5)
Automatic transmission / Clutch paddle and slave Cylinder	N/A	0 ★ ★ ★ ★ ★
Transmission oil condition	N/A	0 ★ ★ ★ ★ ★





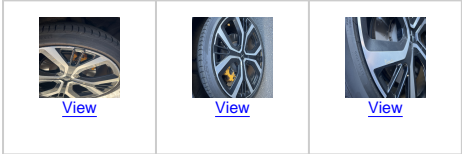




Part	Comments	Rating(Out of 5)
Driveshafts / Tail shaft and Boots condition	Drive shafts inspected with no abnormal noise, vibration or damage noted at time of inspection.	5 ★ ★ ★ ★ ★
Front / Rear Differentials	N/A	0 ★ ★ ★ ★ ★
Drive line images	N/A	0 ★ ★ ★ ★ ★






Performance and Control

Part	Comments	Rating (Out of 5)
Tyres, Wheels / Rims & Spare wheel / Repair kit	Tyres good Rims poor has several scratches 	3 ★ ★ ★ ★ ★
Braking (Discs, Pads, master, calliper, hoses)		5 ★ ★ ★ ★ ★
Sway bar link / Torsion bar	Torsion bar very good Sway bar link good	4 ★ ★ ★ ★ ★
Steering rack / Tie rod ends / Ball joints		5 ★ ★ ★ ★ ★
Shock absorbers / Struts / Coil springs		5 ★ ★ ★ ★ ★

Part	Comments	Rating (Out of 5)
Hub assembly / Wheel bearings		5 ★ ★ ★ ★ ★
Suspension bushes / Control Arm bushes	Lower front control bushes has small cracks could be picked up on RWC <div data-bbox="868 517 1331 674" style="border: 1px solid black; padding: 5px; text-align: center;">  View </div>	4 ★ ★ ★ ★ ★




Exterior



Part	Comments	Rating (Out of 5)
Bonnet / Doors / Boot / Seals & Struts	Vehicle has several scratches and dints all around <div data-bbox="868 1037 1407 1496" style="display: flex; flex-wrap: wrap; gap: 5px;"> <div data-bbox="868 1037 1002 1182"> View</div> <div data-bbox="1002 1037 1136 1182"> View</div> <div data-bbox="1136 1037 1270 1182"> View</div> <div data-bbox="1270 1037 1407 1182"> View</div> <div data-bbox="868 1193 1002 1339"> View</div> <div data-bbox="1002 1193 1136 1339"> View</div> <div data-bbox="1136 1193 1270 1339"> View</div> <div data-bbox="1270 1193 1407 1339"> View</div> <div data-bbox="868 1350 1002 1496"> View</div> </div>	0 ★ ★ ★ ★ ★
Head lights / Taillights / Indicators		5 ★ ★ ★ ★ ★

Part	Comments	Rating (Out of 5)
Side mirrors / Fuel cap / Accessories & Rust		5 
Glass / Seals / Moulds		5 
Roof / Convertible / Racks		5 
Front & rear wiper blades		4 
Body Repairs /Panels damage	Multiple scratches and dints all around the vehicle	3 

Interior

Part	Comments	Rating (Out of 5)
------	----------	-------------------

<p>Door locks / Car keys / Service book / Owner's manual</p>	<p>Buyer to confirm with the seller how many keys are supplied with the vehicle and ensure all keys are present and functioning. On this model, keys are digitally paired to the vehicle, and if any keys are missing or not working, replacement typically requires dealer programming and resetting the system, which can be costly.</p>	<p>0</p> <p>★ ★ ★ ★ ★</p>
<p>Carpet / Floor mats / Pedals</p>	<p>Carpet in the footwell area shows noticeable wear and matting, slightly above what would typically be expected for the vehicle's age and kilometres, indicating moderate to high usage.</p> <div data-bbox="868 584 1345 736" style="border: 1px solid #ccc; text-align: center;">  <p>View</p> </div>	<p>3</p> <p>★ ★ ★ ★ ★</p>
<p>Roof lining & accessories / Sunroof (Rear mirror / Sun visors / Interior Lights)</p>	<p>Passenger side sun-visor cover broken therefore it's light can not be activated</p> <div data-bbox="868 873 1345 1025" style="border: 1px solid #ccc; text-align: center;"> <div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>View</p> </div> <div style="text-align: center;">  <p>View</p> </div> </div> </div>	<p>2</p> <p>★ ★ ★ ★ ★</p>
<p>Window / Mirrors operations.</p>		<p>5</p> <p>★ ★ ★ ★ ★</p>
<p>Air conditioning & Heater operation</p>		<p>5</p> <p>★ ★ ★ ★ ★</p>
<p>Head unit / CD player / Radio / Navigation</p>		<p>5</p> <p>★ ★ ★ ★ ★</p>

<p>Dashboard / Air vents / Centre Console / Glove box</p>	<p>Interior needs cleaning also few scratches detected on centre console and glove box</p> <div style="display: flex; justify-content: space-around;"> <div style="text-align: center;">  <p>View</p> </div> <div style="text-align: center;">  <p>View</p> </div> </div>	<p>3</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Steering wheel grip / Horn / Comb switch</p>		<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Park brake operation</p>		<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Fuel gauges / Temperature gauges</p>		<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Car seats condition & operation / Heated, cooling / Seat belts.</p>		<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Owner's Manual – Service Logbook</p>	<p>Owner manual not present</p>	<p>0</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>

Front / Rear wiper operations / Washers

5



Road Test

Part	Comments	Rating (Out of 5)
Exhaust smoke / Engine idling	N/A	0 ★ ★ ★ ★ ★
Engine driving noise / Driveshaft noise or vibration		5 ★ ★ ★ ★ ★
Road handling / Wheel alignment / Steering vibration	Vehicle merges slightly to the left and may need wheel alignment.	4 ★ ★ ★ ★ ★
Braking / ABS operation		5 ★ ★ ★ ★ ★
Gearbox Auto / Manual / Paddle-shift / 4WD Hight & Low / Shifting	N/A	0 ★ ★ ★ ★ ★
Steering and suspension Performance		1 ★ ★ ★ ★ ★
Speedometer / Odometer Functionality / Cruise control		1 ★ ★ ★ ★ ★
Turbo Charger / Super Charger / Kickdown	Kick down very responsive	5 ★ ★ ★ ★ ★
Vehicle general drivability	Apart from the slight merge to the left vehicle drives very nicely	4 ★ ★ ★ ★ ★

Part	Comments	Rating (Out of 5)
Speed limit when tested	60km/h	0 ★ ★ ★ ★ ★

This report is generated by

