

Pre Purchase Inspection Report

Holden Commodore SV6

Reference Number: a02fff30-bd0b-4e31-a493-9bcdf705befb



Vehicle Information


VIN
6G1EK5xxxxxxxxxxx

Model Year
2007

Odometer Reading
199621

Registration Number
IAR003

Report Summary

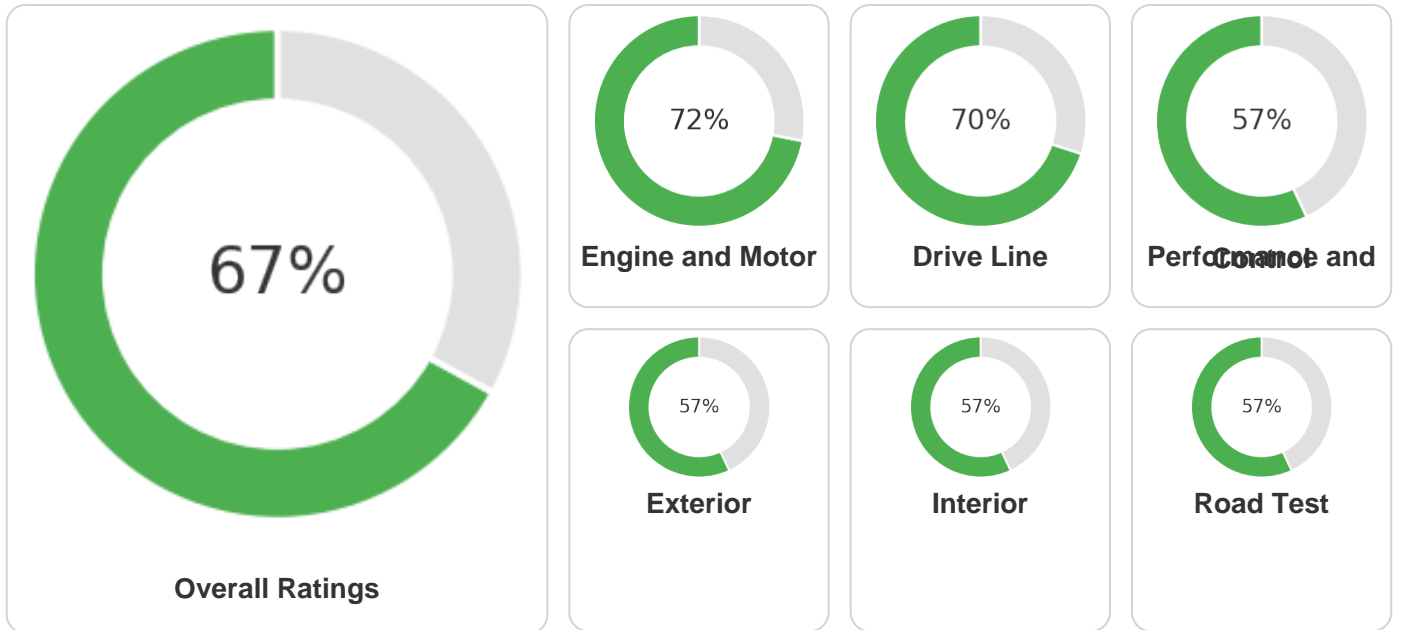


Okba / Inspector









Inspector's overall review





The 2007 Holden Commodore presented for inspection was found to be in generally good condition overall — quite rare to see one this well kept for its age. The engine and transmission performed well during testing, with no major mechanical faults noted. Suspension felt solid, though the front ball joint shows some splitting and will need attention soon. Brakes and front rotors are due for replacement, and the battery and drive belt are also nearing the end of their service life. The rear right door actuator wasn't operating correctly, and the rear driver's taillight has water leak and needs replacement. There's also a minor issue with the windscreen sealing that should be repaired to prevent future leaks. Overall, the vehicle runs well and presents in good shape considering age — just requires a few common wear-and-tear items to bring it up to top condition.

Engine and Motor

Part	Comments	Rating (Out of 5)
Battery health & Alternation operation	Battery failed to start vehicle needed jump start  View	1 ★ ★ ★ ★ ★
Engine bay fluid levels & condition / Washer bottle.	Engine oil looks good but flagging on dashboard needs replacement. Just needs to reset system	4 ★ ★ ★ ★ ★

Part	Comments	Rating(Out of 5)
Radiator fan, Hoses, Reservoir, Thermostats housing and Water pump		4 
Heater hoses, AC condenser, Compressor & Lines		4 
Drive belt and tensioner	Drive belt need replacement makes noise whilst vehicle is running. Tensioner is good	2 
Power steering pump & hoses / Electronic power steering.		4 
Exhaust		N/A
Fuel pump / Fuel line / fuel injectors		4 
Starter motor		4 
Air intake & induction system (intake manifold, pipes, hoses, air filter housing)		4 
Turbo charger / Super Charger		0 


Part	Comments	Rating(Out of 5)
Engine bay electrical (fuse box, relays, main wiring looms, battery terminals)	 View	4 ★ ★ ★ ★ ★
Oil cap deposit, Head gasket leakage, Oil leaks, Engine health, Ignition System		4 ★ ★ ★ ★ ★
Engine & transmission mounts.		4 ★ ★ ★ ★ ★
Engine idling		N/A
ECU Scan	No fault codes  View	4 ★ ★ ★ ★ ★

Drive Line

Part	Comments	Rating (Out of 5)
Automatic transmission / Clutch paddle and slave Cylinder		3 ★ ★ ★ ★ ★
Transmission oil condition		0 ★ ★ ★ ★ ★
Driveshafts / Tail shaft and Boots condition		4 ★ ★ ★ ★ ★
Front / Rear Differentials		0 ★ ★ ★ ★ ★
Drive line images		0 ★ ★ ★ ★ ★





Performance and Control

Part	Comments	Rating (Out of 5)












Tyres, Wheels / Rims & Spare wheel / Repair kit	60%	3 ★ ★ ★ ★ ★
Braking (Discs, Pads, master, calliper, hoses)	Front brakes needs replacement. Rear not too bad  View	2 ★ ★ ★ ★ ★
Sway bar link / Torsion bar		4 ★ ★ ★ ★ ★
Steering rack / Tie rod ends / Ball joints	Needs replace	1 ★ ★ ★ ★ ★
Shock absorbers / Struts / Coil springs		3 ★ ★ ★ ★ ★
Hub assembly / Wheel bearings		4 ★ ★ ★ ★ ★
Suspension bushes / Control Arm bushes		3 ★ ★ ★ ★ ★

Exterior

Part	Comments	Rating (Out of 5)
Bonnet / Doors / Boot / Seals & Struts	Bonnet struts needs replace	2 ★ ★ ★ ★ ★ ★
Head lights / Taillights / Indicators	Rear tail lights need replacing	3 ★ ★ ★ ★ ★ ★
Side mirrors / Fuel cap / Accessories & Rust		4 ★ ★ ★ ★ ★ ★

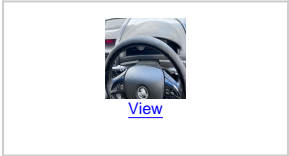Part	Comments	Rating (Out of 5)
Glass / Seals / Moulds	Front windscreen sealing needs replacement deep 	2 
Roof / Convertible / Racks		0 
Front & rear wiper blades		N/A
Body Repairs /Panels damage	Minor couple of dints around nothing major	4 

Interior

Part	Comments	Rating (Out of 5)
Door locks / Car keys / Service book / Owner's manual		N/A
Carpet / Floor mats / Pedals		4 
Roof lining & accessories / Sunroof (Rear mirror / Sun visors / Interior Lights)		0 
Window / Mirrors operations.		4 
Air conditioning & Heater operation	Air con not functioning	1 
Head unit / CD player / Radio / Navigation		4 
Dashboard / Air vents / Centre Console / Glove box		4 
Steering wheel grip / Horn / Comb switch		2 
Park brake operation		4 
Fuel gauges / Temperature gauges		4 
Car seats condition & operation / Heated, cooling / Seat belts.		4 

Part	Comments	Rating (Out of 5)
Owner's Manual – Service Logbook		0 ★ ★ ★ ★ ★
Front / Rear wiper operations / Washers		N/A

Road Test

Part	Comments	Rating (Out of 5)
Exhaust smoke / Engine idling		3 ★ ★ ★ ★ ★
Engine driving noise / Driveshaft noise or vibration		3 ★ ★ ★ ★ ★
Road handling / Wheel alignment / Steering vibration		4 ★ ★ ★ ★ ★
Braking / ABS operation		4 ★ ★ ★ ★ ★
Gearbox Auto / Manual / Paddle-shift / 4WD Hight & Low / Shifting		0 ★ ★ ★ ★ ★
Steering and suspension Performance		4 ★ ★ ★ ★ ★
Speedometer / Odometer Functionality / Cruise control		4 ★ ★ ★ ★ ★
Turbo Charger / Super Charger / Kickdown		0 ★ ★ ★ ★ ★
Vehicle general drivability		4 ★ ★ ★ ★ ★
Speed limit when tested	60	0 ★ ★ ★ ★ ★

This report is generated by

