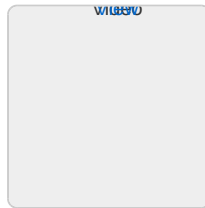
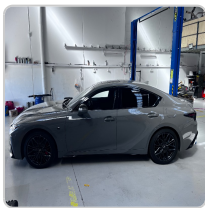


Pre Purchase Inspection Report

Lexus IS500

Reference Number: a06f9263-3ae7-4d3e-960f-3024c74ea4fc



Vehicle Information

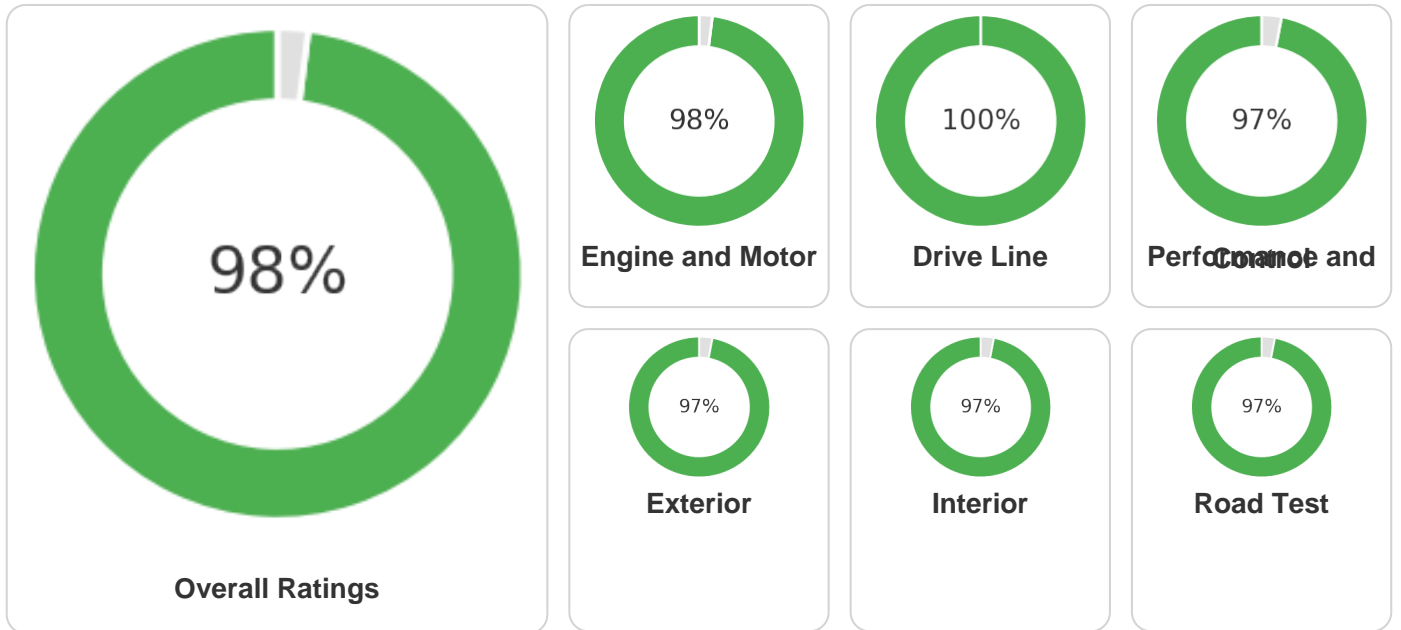
VIN
ABCxxxxxxxx

Model Year
2024

Odometer Reading
4435

Registration Number
N/A

Report Summary








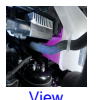
Daniel / Inspector










Inspector's overall review











The 2024 Lexus IS500 presented in very good overall condition, consistent with its age and low kilometres. The vehicle showed no mechanical or structural concerns during the inspection. Performance, engine behaviour, and general drivability were all as expected for this model. The only noted findings were: • Inner tyre wear on the front tyres, a common characteristic with this model due to alignment design. This is not an immediate safety issue but should be monitored and addressed when replacing tyres. • Minor cosmetic scratch on the rear spoiler. This is superficial and does not affect the vehicle's condition or integrity. Aside from these minor points, the vehicle is in excellent condition and has clearly been well maintained. Based on today's inspection, the vehicle is considered a strong example of the IS500 and is suitable for purchase.







Engine and Motor

Part	Comments	Rating (Out of 5)
Battery health & Alternation operation	   View View View	4 ★ ★ ★ ★ ☆
Engine bay fluid levels & condition / Washer bottle.	   View View View	5 ★ ★ ★ ★ ★

Part	Comments	Rating (Outof 5)
Radiator fan, Hoses, Reservoir, Thermostats housing and Water pump	 View View View	5 ★ ★ ★ ★ ★
Heater hoses, AC condenser, Compressor & Lines	 View	5 ★ ★ ★ ★ ★
Drive belt and tensioner	 Video  View	5 ★ ★ ★ ★ ★
Power steering pump & hoses / Electronic power steering.	N/A it has electronic power steering	0 ★ ★ ★ ★ ★
Exhaust		N/A
Fuel pump / Fuel line / fuel injectors	 View  View	5 ★ ★ ★ ★ ★
Starter motor		5 ★ ★ ★ ★ ★
Air intake & induction system (intake manifold, pipes, hoses, air filter housing)	 View  View	5 ★ ★ ★ ★ ★
Turbo charger / Super Charger	N/A	0 ★ ★ ★ ★ ★
Engine bay electrical (fuse box, relays, main wiring looms, battery terminals)	 View	5 ★ ★ ★ ★ ★















Part	Comments	Rating (Out of 5)
Oil cap deposit, Head gasket leakage, Oil leaks, Engine health, Ignition System	  View	5 
Engine & transmission mounts.		5 
Engine idling		N/A
ECU Scan	No fault codes    View	5 


Drive Line

Part	Comments	Rating (Out of 5)
Automatic transmission / Clutch paddle and slave Cylinder		5 
Transmission oil condition		5 
Driveshafts / Tail shaft and Boots condition		5 
Front / Rear Differentials	N/A	0 
Drive line images	 View	5 






Performance and Control

Part	Comments	Rating (Out of 5)

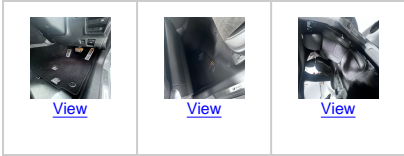
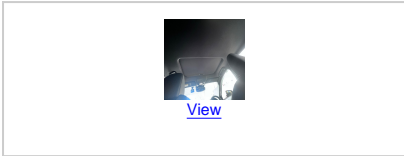
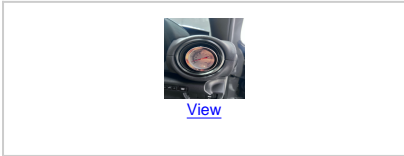
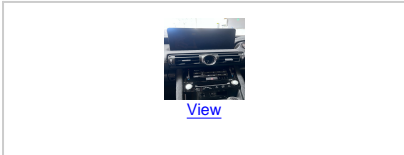
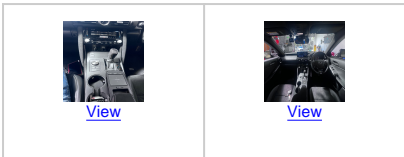
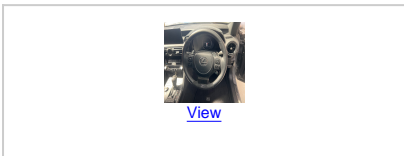
<p>Tyres, Wheels / Rims & Spare wheel / Repair kit</p>	<p>Tyres are, both front tyres are a little bit worn out from the inner edges (common issues)</p> <div style="display: flex; flex-wrap: wrap;"> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> </div> <div style="display: flex; flex-wrap: wrap;"> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> </div> <div style="text-align: center; margin-top: 10px;">  View </div>	<p>4</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Braking (Discs, Pads, master, calliper, hoses)</p>	<div style="display: flex; flex-wrap: wrap;"> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> <div style="width: 25%; text-align: center;">  View </div> </div>	<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Sway bar link / Torsion bar</p>	<div style="text-align: center;">  View </div>	<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Steering rack / Tie rod ends / Ball joints</p>		<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>
<p>Shock absorbers / Struts / Coil springs</p>		<p>5</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p> <p>★</p>

Hub assembly / Wheel bearings		5 ★ ★ ★ ★ ★
Suspension bushes / Control Arm bushes	 View	5 ★ ★ ★ ★ ★

Exterior


Part	Comments	Rating (Out of 5)
Bonnet / Doors / Boot / Seals & Struts	 View	5 ★ ★ ★ ★ ★
Head lights / Taillights / Indicators		5 ★ ★ ★ ★ ★
Side mirrors / Fuel cap / Accessories & Rust	 View  View	5 ★ ★ ★ ★ ★
Glass / Seals / Moulds		5 ★ ★ ★ ★ ★
Roof / Convertible / Racks	 View	5 ★ ★ ★ ★ ★
Front & rear wiper blades		N/A
Body Repairs / Panels damage	Minor scratches on spoiler  View	4 ★ ★ ★ ★ ☆

Interior

Part	Comments	Rating (Out of 5)
Door locks / Car keys / Service book / Owner's manual		N/A
Carpet / Floor mats / Pedals		5 ★ ★ ★ ★ ★
Roof lining & accessories / Sunroof (Rear mirror / Sun visors / Interior Lights)		5 ★ ★ ★ ★ ★
Window / Mirrors operations.		5 ★ ★ ★ ★ ★
Air conditioning & Heater operation		5 ★ ★ ★ ★ ★
Head unit / CD player / Radio / Navigation		5 ★ ★ ★ ★ ★
Dashboard / Air vents / Centre Console / Glove box		5 ★ ★ ★ ★ ★
Steering wheel grip / Horn / Comb switch		5 ★ ★ ★ ★ ★
Park brake operation		5 ★ ★ ★ ★ ★
Fuel gauges / Temperature gauges		5 ★ ★ ★ ★ ★

Part	Comments	Rating (Outof 5)
Car seats condition & operation / Heated, cooling / Seat belts.		5 ★ ★ ★ ★ ★
Owner's Manual – Service Logbook	Present	5 ★ ★ ★ ★ ★
Front / Rear wiper operations / Washers		N/A

Road Test

Part	Comments	Rating (Out of 5)
Exhaust smoke / Engine idling		5 ★ ★ ★ ★ ★
Engine driving noise / Driveshaft noise or vibration		5 ★ ★ ★ ★ ★
Road handling / Wheel alignment / Steering vibration		5 ★ ★ ★ ★ ★
Braking / ABS operation		5 ★ ★ ★ ★ ★
Gearbox Auto / Manual / Paddle-shift / 4WD Hight & Low / Shifting	N/A	0 ★ ★ ★ ★ ★
Steering and suspension Performance		5 ★ ★ ★ ★ ★
Speedometer / Odometer Functionality / Cruise control	 View	5 ★ ★ ★ ★ ★
Turbo Charger / Super Charger / Kickdown	N/A	0 ★ ★ ★ ★ ★
Vehicle general drivability		5 ★ ★ ★ ★ ★
Speed limit when tested	80km/h	0 ★ ★ ★ ★ ★

This report is generated by

